

Certified Inspection Report for:			Contact:	Order No:	327 514	Site Address:		SH EET	
Staverton Parish Council			Sue Porter			Braunston Lane, Staverton NN11 6JF		1	
3 Packwood Close, Daventry NN11 8AJ			Tel: 01327 301 570 / 07973 780 291					of	
			Email: <a href="mailto:stavertonclerk@btinternet.com">stavertonclerk@btinternet.com</a>					4	
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS		QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2.6m 2 Bay 4 Seat Swing	unknown	M	Bushes are worn at the swing bearings on 3 seat positions.						
2 x Flat & 2 x Cradle Seats			New swing bearings from an unknown source have been						
on Tiles			fitted at 1 seat position.						
		M	Recommend worn chains on both cradle seats are replaced.						
		M	Recommend worn links at the top of the chains on both flat						
			seats are replaced.						
			Wicksteed cannot identify the manufacturer and are						
			therefore unable to quote for repairs to this swing.						
		L	Fails BS EN 1176 recommended clearance dimensions						
			between the seats and between seats to frame members						

			(ref BS EN 1176:2008 Part 2, section 4.4.1) No remedial					
			action is feasible with the swing frame.					
		<b>M</b>	Tile surface is wearing, in addition, gaps at the joints and					
			uneven surfaces could create trip hazards, no remedial					
			action possible with the existing tiles and given the age &					
			condition of the unit a surface upgrade may not be					
			economically viable, consideration should be given to					
			removing or upgrading the unit and surfacing as soon as					
			resources permit.					
<b>Link Non Bump See Saw (LNB)</b>	<b>Wick steed</b>	<b>M</b>	Generally satisfactory but protruding flange plates below					
<b>on Tiles</b>	<b>2001</b>		the seats create potential collision and impact hazards,					
			recommend the plates are removed (plates should have					
			been removed when new seats were fitted)					
<b>4.5m Embankment Slide</b>	<b>Wick steed</b>	<b>L</b>	Generally satisfactory but recommend the handrail and					
<b>on Grass Mound</b>			chute support legs are painted as soon as possible to					
			prevent further deterioration.					
		<b>L</b>	Recommend regular grounds maintenance to combat					
			erosion and reduce potential slip and trip hazards,					
			especially at the slide run out.					
		<b>L</b>	Metal slide chute faces towards the sun. Monitor for high					
			temperatures during hot, sunny weather.					



								<b>Staverton NN11 6JF</b>		
<b>3 Packwood Close, Daventry NN11 8AJ</b>			<b>Tel: 01327 301 570 / 07973 780 291</b>							<b>of</b>
			<b>Email: <a href="mailto:stavertonclerk@btinternet.com">stavertonclerk@btinternet.com</a></b>							<b>4</b>
DESCRIP TION OF PRODU CT(S) INSPEC TED	MAKER & YEARS	RISK RAT ING	INSPECTION COMMENTS	QTY.	PRO DUC T COD E	DESCRIP TION OF PART(S) REQUI RED	UNI T PRI CE	TO TA L		
<b>Whirlybird Roundabout on Tiles</b>	<b>Wicksteed</b>	<b>M</b>	Generally satisfactory but the surface is wearing, in							
			addition, gaps at tile joints could create trip hazards,							
			recommend surface upgrade as soon as resources permit.							
		<b>M</b>	Monitor wear at the bearings, recommend replace within	<b>1</b>	2546-003	Bottom Bearing (SKF320086)	£20.00		<b>£20.00</b>	
			12 months (Ensure that the regular greasing of the	<b>1</b>	2546-004	Top Bearing	£20.00		<b>£20.00</b>	
			bearings is included within your annual maintenance	<b>1</b>	2221-008	3/16" x 2" Split Pin	£0.45		<b>£0.45</b>	
			schedule.)			<b>Labour cost to fit bearings*</b>	<b>£160.00</b>			
<b>Timber Cabin &amp; Access Bridge on Grass &amp; Tiles</b>	<b>unknown</b>	<b>MH</b>	2 support posts are missing at 1 end of the bridge. This end							
			of the bridge is not secure, and may fail without warning.							

		<b>M</b>	Wood rot evident on the access ramp to the bridge.					
		<b>M</b>	The unit is easily accessible by all age groups, the provision					
			of barriers is recommended where platform height is					
			greater than 600mm from the playing surface (tower & bridge)					
			(ref BS EN-1: 2008, clauses 4.2.4.1 & 4.2.4.4)					
		<b>L</b>	The provision of handrails at the bridge access ramp is					
			recommended, and should commence from the lowest					
			part of the ramp (ref BS EN-1: 2008, clause 4.2.4.1)					
		<b>L</b>	The top of the tower barriers are less than 700mm from					
			the platform surface (ref BS EN 1176-1:2008, clause					
			4.2.4.4), 550mm actual height, however, any extension to					
			the barrier height is likely to create a head or torso					
			entrapment hazard with the tower roof cross member.					
			(ref BS EN:1176-1:2008, clause 4.2.7.2)					
		<b>L</b>	Monitor ramp hand grips, further deterioration at top grip					
			could result in sharp edge snagging hazards.					
		<b>M</b>	Tile surface is wearing, in addition, gaps at the joints and					
			uneven surfaces could create trip hazards, no remedial					
			action possible with the existing tiles.					
			Given the age and general condition of this unit, repairs					
			are unlikely to be feasible. We therefore recommend that					
			this item is removed from service as soon as possible.					
						Continues on next sheet...		

<b>Wicksteed Leisure Ltd</b>		<b>INDICATION OF RISK RATING ASSESSMENT</b>	INSPECTED BY : -	PARTS SUB TOTAL		<b>£40.45</b>
<b>Digby St., Kettering</b>	H/MH	HIGH & MEDIUM HIGH RISK - See Introductory Notes	<b>A J Hayes</b>	BALANCE C / FORWARD		<b>£0.00</b>
<b>Northants, NN16 8YJ</b>	M	MEDIUM RISK - See Introductory Notes	DATE : -	PARTS TOTAL EXC. CARRIAGE & VAT.	(E&O.E.)	<b>£40.45</b>
<b>Tel: 01536 517 028</b>	VL/L	VERY LOW & LOW RISK - See Introductory Notes	<b>30. 03. 2016</b>	LABOUR TO FIT PARTS * Based on all works ordered		<b>See sheet 4</b>

<b>Certified Inspection Report for:</b>			<b>Contact:</b>	<b>Order No:</b>	<b>327 514</b>	<b>Site Address:</b>		<b>SH E E T</b>
<b>Staverton Parish Council</b>			<b>Sue Porter</b>			<b>Braunston Lane, Staverton NN11 6JF</b>		<b>3</b>
<b>3 Packwood Close, Daventry NN11 8AJ</b>			<b>Tel: 01327 301 570 / 07973 780 291</b>					<b>of</b>
			<b>Email: <a href="mailto:stavertonclerk@btinternet.com">stavertonclerk@btinternet.com</a></b>					<b>4</b>
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
	<b>Wicksteed</b>	<b>L</b>	Generally satisfactory, but hand supports fail BS EN 1176					

<b>Elephant Spring Mobile</b>								
<b>on Grass &amp; Tiles</b>	<b>1999</b>		Ring Gauge Test (Ref BS EN 1176:2008 Part 6 Section					
			4.7) No remedial action is recommended at present.					
<b>Horse Spring Mobile</b>	<b>Wicksteed</b>		Satisfactory condition.					
<b>on Grass</b>	<b>2001</b>							
<b>Multi-Sports Goal</b>	<b>SMP</b>		Satisfactory condition, inspected to BS 15312:2007 relating					
<b>on Tarmac</b>			to free access multi-sports equipment.					
<b>Leaning Post</b>	<b>SMP</b>	<b>L</b>	Generally satisfactory but monitor the paint condition.					
<b>on Grass &amp; Tarmac</b>								
<b>2 x Football Goals</b>	<b>unknown</b>	<b>L</b>	Generally satisfactory but monitor the paint condition.					
<b>on Grass</b>								
<b>2 x Litter Bins</b>	<b>unknown</b>		Satisfactory condition.					
<b>on Grass</b>								
<b>3 x Picnic Tables</b>	<b>unknown</b>	<b>L</b>	Recommend missing / damaged slats are replaced to reduce					
<b>on Grass</b>			splinter / abrasion hazards.					
<b>2 x Park Seats</b>	<b>unknown</b>		Satisfactory condition.					
<b>on Grass &amp; Paving</b>								
<b>Cycle Rack</b>	<b>unknown</b>		Satisfactory condition, but recommend intrusive foliage is					
<b>on Grass</b>			cut back to allow safe access.					

<b>Single Gate</b>			Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2008 Part 1, section 4.2.7.6)				
<b>Vehicle Access Gate</b>			Satisfactory condition (Locked at time of inspection)				
<b>Wicksteed Leisure Ltd</b>			<b>INDICATION OF RISK RATING ASSESSMENT</b>	<b>INSPECTED BY :-</b>	<b>PARTS SUB TOTAL</b>		<b>£0.00</b>
<b>Digby St., Kettering</b>		H/M H	HIGH & MEDIUM HIGH RISK - See Introductory Notes	<b>A J Hayes</b>	BALANCE C / FORWARD		<b>£40.45</b>



<b>Northants, NN16 8YJ</b>	<b>M</b>	<b>MEDIUM RISK - See Introductory Notes</b>	<b>DA TE :-</b>	<b>PARTS TOTAL EXC. CARRI AGE &amp; VAT.</b>	<b>(E&amp; O.E. )</b>	<b>£40. 45</b>
<b>Tel: 01536 517 028</b>	<b>VL/ L</b>	<b>VERY LOW &amp; LOW RISK - See Introductory Notes</b>	<b>30. 03. 2016</b>	<b>LABOUR TO FIT PARTS *</b>	<b>Based on all works ordered</b>	<b>See sheet 4</b>

<b>Certified Inspection Report for:</b>			<b>Contact:</b>	<b>Order No:</b>	<b>327 514</b>	<b>Site Address:</b>		<b>SH EE T</b>
<b>Staverton Parish Council</b>			<b>Sue Porter</b>			<b>Braunston Lane, Staverton NN11 6JF</b>		<b>4</b>
<b>3 Packwood Close, Daventry NN11 8AJ</b>			<b>Tel: 01327 301 570 / 07973 780 291</b>					<b>of</b>
			<b>Email: <a href="mailto:stavertonclerk@btinternet.com">stavertonclerk@btinternet.com</a></b>					<b>4</b>
<b>DESCRIPTION OF PRODUCT (S) INSPECTED</b>	<b>MAKE R &amp; YE AR</b>	<b>RISK RAT ING</b>	<b>INSPECTION COMMENTS</b>	<b>QT Y.</b>	<b>PRO DUC T COD E</b>	<b>DESCR PTION OF PART(S) REQUI RED</b>	<b>UNI T PRI CE</b>	<b>TO TA L</b>
<b>Fence / Hedge</b>			Satisfactory condition.					
<b>Operator's Sign</b>		<b>L</b>	Generally satisfactory, but note that the following			A variety of signs are available		
			information is recommended, in pictogram form:			from Wicksted Sales Dept		

		a) General emergency telephone number (999 or 112)					
		b) Telephone number to contact maintenance personnel					
		c) Name of the playground					
		d) Address of the playground					
		e) Other relevant local information, if applicable					
		(ref: BS EN 1176-7:2008 clause 8.2.4)					
<b>General</b>	<b>L</b>	Recommend grass cuttings are removed from the safety					
		surfaces to reduce slip hazards and future deterioration					
		of the surfaces.					
<b>Wicksteed Leisure Ltd</b>		<b>INDICATION OF RISK RATING ASSESSMENT</b>	<b>INSPECTED BY :-</b>	<b>PARTS SUB TOTAL</b>		<b>£0.00</b>	
<b>Digby St., Kettering</b>	H/M H	HIGH & MEDIUM HIGH RISK - See Introductory Notes	<b>A J Hayes</b>	<b>BALANCE C / FORWARD</b>		<b>£40.45</b>	
<b>Northants, NN16 8YJ</b>	M	MEDIUM RISK - See Introductory Notes	<b>DATE :-</b>	<b>PARTS TOTAL EXC. CARRIAGE &amp; VAT.</b>	<b>(E&amp;O.E.)</b>	<b>£40.45</b>	

Tel: 01536 517 028	VL/ L	VERY LOW & LOW RISK - See Introductory Notes	30. 03. 2016	LABOUR TO FIT PARTS * Based on all works ordered	£16 0.00
<a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>				TOTAL COST OF WORKS, EXC VAT	£20 0.45